



INNEHÅLL

Sida	297	Raka adapter, utv. gängor
	306	Svetsadapter
	308	Raka adapter, utv./inv. gängor
	311	Raka adapter, inv. gängor
	313	Pluggar, huvar
	317	Vinkeladapter
	321	T-adapter
	324	Ställbara adapter
	327	Banjodapter
	329	Trycktabell

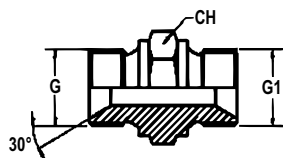


030136 Liksidig adapter utv. R-gänga

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	G1			
030136-02-02	1/8"-28	1/8"-28	14	35,0	038136-02-02
-04-04	1/4"-19	1/4"-19	19	35,0	-04-04
-06-06	3/8"-19	3/8"-19	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	27	31,5	-08-08
-10-10	5/8"-14	5/8"-14	30	31,5	-10-10
-12-12	3/4"-14	3/4"-14	32	25,0	-12-12
-16-16	1"-11	1"-11	41	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	50	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	55	12,5	-24-24
-32-32	2"-11	2"-11	70	8,0	-32-32

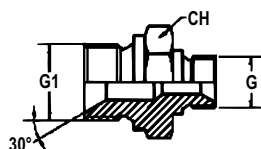


030135 Oliksidig adapter utv. R-gänga

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	G1			
030135-02-04	1/8"-28	1/4"-19	19	35,0	038135-02-04
-02-06	1/8"-28	3/8"-19	22	35,0	-02-06
-02-08	1/8"-28	1/2"-14	27	31,5	-02-08
-04-06	1/4"-19	3/8"-19	22	35,0	-04-06
-04-08	1/4"-19	1/2"-14	27	31,5	-04-08
-04-12	1/4"-19	3/4"-14	32	20,0	-04-12
-06-08	3/8"-19	1/2"-14	27	31,5	-06-08
-06-10	3/8"-19	5/8"-14	30	31,5	-06-10
-06-12	3/8"-19	3/4"-14	32	25,0	-06-12
-06-16	3/4"-19	1"-11	41	20,0	-06-16
-08-10	1/2"-14	5/8"-14	30	31,5	-08-10
-08-12	1/2"-14	3/4"-14	32	25,0	-08-12
-08-16	1/2"-14	1"-11	41	20,0	-08-16
-08-20	1/2"-14	1 1/4"-11	50	16,0	-08-20
-10-12	5/8"-14	3/4"-14	32	25,0	-10-12
-12-16	3/4"-14	1"-11	41	20,0	-12-16
-12-20	3/4"-14	1 1/4"-11	50	16,0	-12-20
-16-20	1"-11	1 1/4"-11	50	16,0	-16-20
-16-24	1"-11	1 1/2"-11	55	12,5	-16-24
-20-24	1 1/4"-11	1 1/2"-11	55	12,5	-20-24
-20-32	1 1/4"-11	2"-11	70	8,0	-20-32
-24-32	1 1/2"-11	2"-11	70	8,0	-24-32

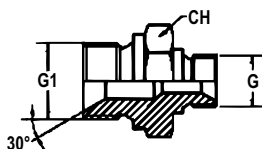


030139 Strypadapter utv. R-gänga

Det.nr.	Gänga		Dimension mm	Hål mm	Arb.tryck MPa
	G	G1			
030139-00-01	3/8"-19	3/8"-19	22	1,0	35,0
-00-02	1/4"-19	1/4"-19	19	1,0	35,0
-00-03	1/4"-19	1/4"-19	19	1,5	35,0
-00-05	3/8"-19	3/8"-19	22	1,0	35,0
-00-06	3/8"-19	3/8"-19	22	2,5	35,0
-68-01	3/8"-19	1/2"-14	27	1,0	31,5

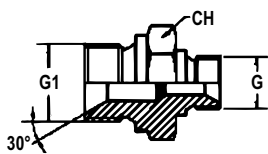


030139 Oborrade adapter utv. R-gänga

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	G	G1		
030139-04-04	1/4"-19	1/4"-19	19	35,0
-04-06	1/4"-19	3/8"-19	22	35,0
-04-08	1/4"-19	1/4"-14	27	35,0
-06-06	3/8"-19	3/8"-19	22	35,0
-06-08	3/8"-19	1/2"-14	27	31,5
-08-08	1/2"-14	1/2"-14	27	31,5

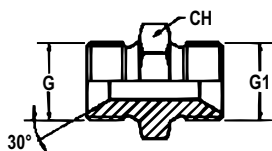


030143 Adapter utv. metrisk gänga, 60° kona

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	G	G1		
030143-10-10	M10x1,0	M10x1,0	14	35,0
-12-12	M12x1,5	M12x1,5	17	35,0
-14-14	M14x1,5	M14x1,5	19	35,0
-16-16	M16x1,5	M16x1,5	22	35,0
-18-18	M18x1,5	M18x1,5	24	35,0
-20-20	M20x1,5	M20x1,5	27	31,5
-22-22	M22x1,5	M22x1,5	27	31,5
-24-24	M24x1,5	M24x1,5	30	31,5
-26-26	M26x1,5	M26x1,5	32	25,0
-30-30	M30x1,5	M30x1,5	38	20,0

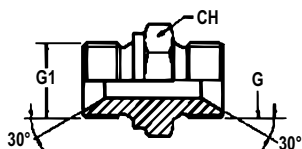

030147 Adapter utv. M-gänga/utv. R-gänga, 60° kona


Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	M	BSP		
	G	G1	CH	
030147-12-04	M12x1,5	1/4"-19	19	35,0
-12-06	M12x1,5	3/8"-19	22	35,0
-14-04	M14x1,5	1/4"-19	19	35,0
-14-06	M14x1,5	3/8"-19	22	35,0
-16-04	M16x1,5	1/4"-19	22	35,0
-16-06	M16x1,5	3/8"-19	22	35,0
-16-08	M16x1,5	1/2"-14	27	31,5
-18-04	M18x1,5	1/4"-19	24	35,0
-18-06	M18x1,5	3/8"-19	24	31,5
-18-08	M18x1,5	1/2"-14	27	31,5
-18-12	M18x1,5	3/4"-14	32	25,0
-22-08	M22x1,5	1/2"-14	27	31,5
-22-12	M22x1,5	3/4"-14	32	25,0
-26-12	M26x1,5	3/4"-14	32	25,0

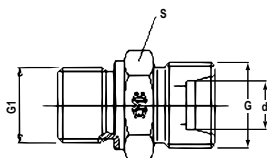

70101xx169 Adapter utv. fast M-gänga 24° kona/ utv. fast R-gänga 60° kona. Serie L

Det.nr.	Beteckning	Gänga		Rör dim (xx) mm	Dimension mm	Arb.tryck MPa
		G	G1	d	S	
7010106169	XGE-6LR/A	M12x1,5	1/8"	6	14	40,0
-19106169	-6LR1/4"/A	M12x1,5	1/4"	6	19	40,0
-18106169	-6LR3/8"/A	M12x1,5	3/8"	6	22	40,0
-10108169	-8LR/A	M14x1,5	1/4"	8	19	40,0
-18108169	-8LR1/8"/A	M14x1,5	1/8"	8	14	40,0
-19108169	-8LR3/8"/A	M14x1,5	3/8"	8	22	40,0
-10110169	-10LR/A	M16x1,5	1/4"	10	19	40,0
-19110169	-10LR3/8"/A	M16x1,5	3/8"	10	22	40,0
-17110169	-10LR1/2"/A	M16x1,5	1/2"	10	19	40,0
-10112169	-12LR/A	M18x1,5	3/8"	12	22	40,0
-18112169	-12LR1/4"/A	M18x1,5	1/4"	12	19	40,0
-19112169	-12LR1/2"/A	M18x1,5	1/2"	12	27	40,0
-17112169	-12LR3/4"/A	M18x1,5	3/4"	12	32	40,0
-10115169	-15LR/A	M22x1,5	1/2"	15	27	40,0
-19115169	-15LR3/8"/A	M22x1,5	3/8"	15	24	40,0
-17115169	-15LR3/4"/A	M22x1,5	3/4"	15	32	40,0
-10118169	-18LR/A	M26x1,5	1/2"	18	27	40,0
-18118169	-18LR3/8"/A	M26x1,5	3/8"	18	27	40,0
-19118169	-18LR3/4"/A	M26x1,5	3/4"	18	32	40,0
-10122169	-22LR/A	M30x2	3/4"	22	32	25,0
-18122169	-22LR1/2"/A	M30x2	1/2"	22	32	25,0
-19122169	-22LR1"/A	M30x2	1"	22	41	25,0
-10128169	-28LR/A	M36x2	1"	28	41	25,0
-18128169	-28LR1/2"/A	M36x2	1/2"	28	41	25,0
-19128169	-28LR3/4"/A	M36x2	3/4"	28	41	25,0
-17128169	-28LR1 1/4"/A	M36x2	1 1/4"	28	50	25,0
-10135169	-35LR/A	M45x2	1 1/4"	35	50	25,0
-10142169	-42LR/A	M52x2	1 1/2"	42	55	25,0

xx=Rördim.

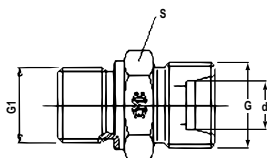


70101xx269 Adapter utv. fast M-gänga 24° kona/ utv. fast R-gänga 60° kona. Serie S

Det.nr.	Beteckning	Gänga		Rör dim (xx) mm	Dimension mm	Arb.tryck MPa
		G	G1	d	S	
7010106269	XGE-6SR/A	M14x1,5	1/4"	6	19	63,0
-10108269	-8SR/A	M16x1,5	1/4"	8	19	63,0
-10110269	-10SR/A	M18x1,5	3/8"	10	22	63,0
-10112269	-12SR/A	M20x1,5	3/8"	12	22	63,0
-19112269	-12SR1/2"/A	M20x1,5	1/2"	12	27	63,0
-10116269	-16SR/A	M24x1,5	1/2"	16	27	63,0
-10120269	-20SR/A	M30x2	3/4"	20	32	40,0
-10125269	-25SR/A	M36x2	1"	25	41	40,0
-10130269	-30SR/A	M42x2	1 1/4"	30	50	25,0
-10138269	-38SR/A	M52x2	1 1/2"	38	55	25,0

xx=Rördim.


Andra dimensioner på förfrågan.

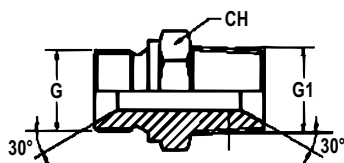

031320 Liksidig adapter utv. R-gänga/KR-gänga

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH		
031320-02-02	1/8"-28	1/8"-28	14	35,0	038320-02-02
-04-04	1/4"-19	1/4"-19	19	35,0	-04-04
-06-06	3/8"-19	3/8"-19	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	27	31,5	-08-08
-12-12	3/4"-14	3/4"-14	32	25,0	-12-12
-16-16	1"-11	1"-11	41	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	50	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	55	12,5	-24-24
-32-32	2"-11	2"-11	70	8,0	-32-32


Oliksidiga adapter på förfrågan.

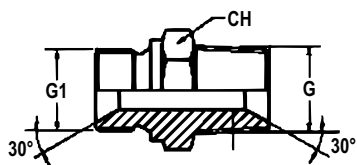

030543 Olikssidig adapter NPTF-gänga/utv. R-gänga


Det.nr.	Gänga		Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	NPTF	BSP			
	G	G1	CH		
030543-02-04	1/8"-27	1/4"-19	19	35,0	038543-02-04
-04-06	1/4"-18	3/8"-19	22	35,0	-04-06
-06-04	3/8"-18	1/4"-19	19	35,0	-06-04
-06-08	3/8"-18	1/2"-14	27	31,5	-06-08
-08-06	1/2"-14	3/8"-19	22	31,5	-08-04
-08-12	1/2"-14	3/4"-14	32	25,0	-08-12
-12-08	3/4"-14	1/2"-14	27	25,0	-12-08
-12-16	3/4"-14	1"-11	41	20,0	-12-16
-16-12	1"-11,5	3/4"-14	41	20,0	-16-12
-16-20	1"-11,5	1 1/4"-11	50	16,0	-16-20

Andra dimensioner på förfrågan.

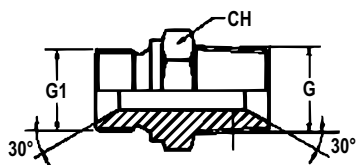

030544 Likssidig adapter NPTF-gänga/utv. R-gänga


Det.nr.	Gänga		Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	G1			
	G	G1	CH		
030544-02-02	1/8"-27	1/8"-28	14	35,0	038544-02-02
-04-04	1/4"-18	1/4"-19	19	35,0	-04-04
-06-06	3/8"-18	3/8"-19	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	27	31,5	-08-08
-12-12	3/4"-14	3/4"-14	32	25,0	-12-12
-16-16	1"-11,5	1"-11	41	20,0	-16-16
-20-20	1 1/4"-11,5	1 1/4"-11	50	16,0	-20-20
-24-24	1 1/2"-11,5	1 1/2"-11	55	12,5	-24-24
-32-32	2"-11,5	2"-11	70	8,0	-32-32

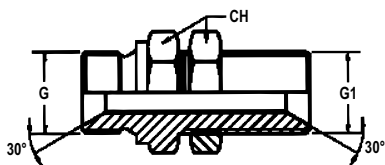

031260 Skottgenomgång R-gänga


Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	G	G1	CH	
031260-04-04	1/4"-19	1/4"-19	19	35,0
-06-06	3/8"-19	3/8"-19	22	35,0
-08-08	1/2"-14	1/2"-14	27	31,5
-12-12	3/4"-14	3/4"-14	32	25,0
-16-16	1"-11	1"-11	41	20,0

Syrafast utförande, komplett adapter + kontramutter = 038265 dim.

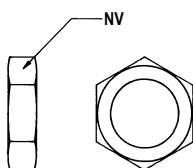


031270 Kontramutter för skottgenomgång

Det.nr.	Gänga	Dimension mm
	BSP	NV
031270-04-00	1/4"-19	19
-06-00	3/8"-19	22
-08-00	1/2"-14	27
-12-00	3/4"-14	32
-16-00	1"-11	41

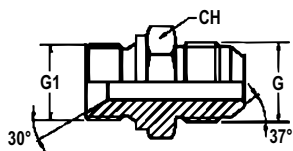


066011 Adapter utv. JIC-gänga/utv. R-gänga

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	G	G1		
066011-04-02	7/16"-20	1/8"-28	14	34,5
-04-04	7/16"-20	1/4"-19	19	34,5
-04-06	7/16"-20	3/8"-19	22	34,5
-05-04	1/2"-20	1/4"-19	19	34,5
-06-04	9/16"-18	1/4"-19	19	34,5
-06-06	9/16"-18	3/8"-19	22	34,5
-06-08	9/16"-18	1/2"-14	27	31,0
-08-04	3/4"-16	1/4"-19	20	31,0
-08-06	3/4"-16	3/8"-19	22	31,0
-08-08	3/4"-16	1/2"-14	27	31,0
-08-12	3/4"-16	3/4"-14	32	24,0
-10-06	7/8"-14	3/8"-19	24	24,0
-10-08	7/8"-14	1/2"-14	27	24,0
-10-12	7/8"-14	3/4"-14	32	24,0
-12-08	1 1/16"-12	1/2"-14	27	24,0
-12-12	1 1/16"-12	3/4"-14	32	24,0
-12-16	1 1/16"-12	1"-11	41	21,0
-16-12	1 5/16"-12	3/4"-14	38	21,0
-16-16	1 5/16"-12	1"-11	41	21,0
-20-16	1 5/8"-12	1"-11	42	17,0
-20-20	1 5/8"-12	1 1/4"-11	50	17,0
-24-20	1 7/8"-12	1 1/4"-11	50	14,0
-24-24	1 7/8"-12	1 1/2"-11	55	14,0
-32-24	2 1/2"-12	1 1/2"-11	65	10,5
-32-32	2 1/2"-12	2"-11	70	10,5

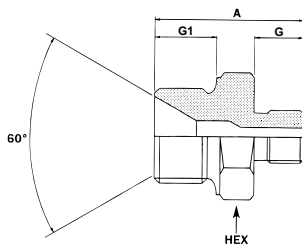

032703 Adapter utv. SAE-gänga med O-ring/utv. R-gänga


Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	G	G1		
032703-04-02	7/16"-20	1/8"-28	14	34,5
-04-04	7/16"-20	1/4"-19	19	34,5
-06-04	9/16"-18	1/4"-19	19	34,5
-06-06	9/16"-18	3/8"-19	22	34,5
-08-06	3/4"-16	3/8"-19	22	31,0
-08-08	3/4"-16	1/2"-14	24	31,0
-10-08	7/8"-14	1/2"-14	27	24,0
-12-12	1 1/16"-12	3/4"-14	32	24,0
-16-12	1 5/16"-12	3/4"-14	38	21,0
-16-16	1 5/16"-12	1"-11	41	21,0

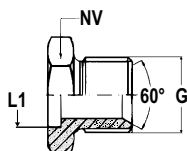

030142 Svetsadapter utv. R-gänga


Det.nr.	Gänga	Dimension mm		Arb.tryck MPa
		L1	NV	
030142-04-10	1/4"-19	10	19	30,0
-04-12	1/4"-19	12	19	30,0
-06-10	3/8"-19	10	22	30,0
-06-12	3/8"-19	12	22	30,0
-06-14	3/8"-19	14	22	30,0
-08-15	1/2"-14	15	27	30,0
-08-16	1/2"-14	16	27	30,0
-08-18	1/2"-14	18	27	30,0
-12-20	3/4"-14	20	32	28,0
-12-22	3/4"-14	22	32	28,0
-12-25	3/4"-14	25	32	28,0
-16-25	1"-11	25	41	28,0
-16-30	1"-11	30	41	28,0

Andra dimensioner och gängor på förfrågan.



030149 Svetsnippel med utv. R-gänga

Det.nr.	Gänga	Dimension mm		Arb.tryck MPa	Det.nr. syrafast
		ØD	Ød1		
030149-02-00	1/8"-28	10	4	30,0	038149-04-00 -06-00 -08-00 -12-00 -16-00
-04-00	1/4"-19	14	6	30,0	
-06-00	3/8"-19	17	8	30,0	
-08-00	1/2"-14	21	12	30,0	
-12-00	3/4"-14	28	15	28,0	
-16-00	1"-11	32	21	28,0	
-20-00	1 1/4"-11	42	28	28,0	

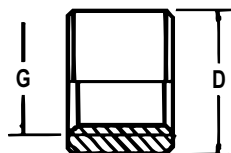

030249 Svetsmuff med inv. R-gänga

Det.nr.	Gänga	Dimension mm	Arb.tryck MPa
	G	ØD	
030249-02-00	1/8"-28	18	30,0
-04-00	1/4"-19	22	30,0
-06-00	3/8"-19	25	30,0
-08-00	1/2"-14	30	30,0
-12-00	3/4"-14	38	30,0
-16-00	1"-11	45	30,0
-20-00	1 1/4"-11	55	30,0

Radiefrästa modeller på förfrågan.



030827 Vinkelsvetsnippel 90° inv. R-gänga


Det.nr.	Gänga	Dimension mm		Arb.tryck MPa
	G	ØD	ØD1	
030827-04-00	1/4"-19	15,0	20,0	34,0
-06-00	3/8"-19	19,9	24,8	28,0
-08-00	1/2"-14	25,0	30,0	23,0



030829 Vinkelsvetsnippel 90° utv. R-gänga


Det.nr.	Gänga	Dimension mm	Arb.tryck MPa
	G	ØD	
030829-04-00	1/4"-19	16,0	35,0
-06-00	3/8"-19	16,7	33,0
-08-00	1/2"-14	22,0	30,0

Metrisk varianter se katalog för skärningskopplingar.

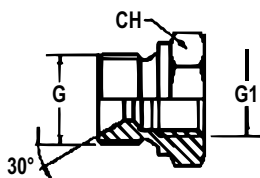


030234 Adapter utv. R-gänga/inv. R-gänga, lågbyggd

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	G	G1		
030234-04-02	1/4"-19	1/8"-28	19	35,0
-06-04	3/8"-19	1/4"-19	22	35,0
-08-04	1/2"-14	1/4"-19	27	31,5
-08-06	1/2"-14	3/8"-19	27	31,5
-12-04	3/4"-14	1/4"-19	32	25,0
-12-06	3/4"-14	3/8"-19	32	25,0
-12-08	3/4"-14	1/2"-14	32	25,0
-16-06	1"-11	3/8"-19	41	20,0
-16-08	1"-11	1/2"-14	41	20,0
-16-12	1"-11	3/4"-14	41	20,0
-20-12	1 1/4"-11	3/4"-14	50	16,0
-20-16	1 1/4"-11	1"-11	50	16,0
-24-16	1 1/2"-11	1"-11	55	12,5
-24-20	1 1/2"-11	1 1/4"-11	55	12,5
-32-20	2"-11	1 1/4"-11	70	8,0
-32-24	2"-11	1 1/2"-11	70	8,0

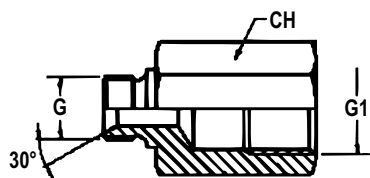


030235 Adapter utv. R-gänga/inv. R-gänga, oliksidig

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	G	G1		
030235-02-04	1/8"-28	1/4"-19	19	35,0
-04-02	1/4"-19	1/8"-28	19	35,0
-04-06	1/4"-19	3/8"-19	22	35,0
-06-04	3/8"-19	1/4"-19	22	35,0
-06-08	3/8"-19	1/2"-14	27	31,5
-08-06	1/2"-14	3/8"-19	27	31,5
-08-10	1/2"-14	5/8"-14	30	31,5
-08-12	1/2"-14	3/4"-14	32	25,0
-10-08	5/8"-14	1/2"-14	30	31,5
-12-08	3/4"-14	1/2"-14	32	25,0
-12-16	3/4"-14	1"-11	41	20,0
-16-12	1"-11	3/4"-14	41	20,0
-16-20	1"-11	1 1/4"-11	50	16,0
-20-16	1 1/4"-11	1"-11	50	16,0
-20-24	1 1/4"-11	1 1/2"-11	55	12,5
-24-20	1 1/2"-11	1 1/4"-11	55	12,5
-24-32	1 1/2"-11	2"-11	70	8,0
-32-24	2"-11	1 1/2"-11	70	8,0

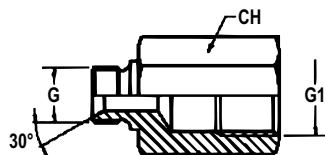


030236 Adapter utv. R-gänga/inv. R-gänga, liksidig

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	G1			
030236-02-02	1/8"-28	1/8"-28	14	35,0	038236-02-02
-04-04	1/4"-19	1/4"-19	19	35,0	-04-04
-06-06	3/8"-19	3/8"-19	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	27	31,5	-08-08
-10-10	5/8"-14	5/8"-14	30	31,5	
-12-12	3/4"-14	3/4"-14	32	25,0	-12-12
-16-16	1"-11	1"-11	41	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	50	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	55	12,5	-24-24
-32-32	2"-11	2"-11	70	8,0	-32-32

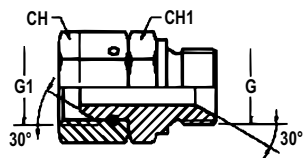


030703 Adapter utv. fast R-gänga/inv. rörlig R-gänga

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH	CH1		
030703-02-02	1/8"-28	1/8"-28	14	14	35,0	038703-02-02
-02-04	1/8"-28	1/4"-19	14	19	35,0	-02-04
-04-02	1/4"-19	1/8"-28	19	14	35,0	-04-02
-04-04	1/4"-19	1/4"-19	19	19	35,0	-04-04
-04-06	1/4"-19	3/8"-19	19	22	35,0	-04-06
-04-08	1/4"-19	1/2"-14	19	27	31,5	-04-08
-06-04	3/8"-19	1/4"-19	22	19	35,0	-06-04
-06-06	3/8"-19	3/8"-19	22	22	35,0	-06-06
-06-08	3/8"-19	1/2"-14	22	27	31,5	-06-08
-08-04	1/2"-14	1/4"-19	27	19	31,5	-08-04
-08-06	1/2"-14	3/8"-19	27	22	31,5	-08-06
-08-08	1/2"-14	1/2"-14	27	27	31,5	-08-08
-08-12	1/2"-14	3/4"-14	27	32	25,0	-08-12
-08-16	1/2"-14	1"-11	27	41	20,0	
-10-08	5/8"-14	1/2"-14	30	27	31,5	
-10-10	5/8"-14	5/8"-14	30	28	31,5	
-10-12	5/8"-14	3/4"-14	30	32	25,0	
-12-08	3/4"-14	1/2"-14	32	27	25,0	038703-12-08
-12-10	3/4"-14	5/8"-14	32	28	25,0	
-12-12	3/4"-14	3/4"-14	32	32	25,0	038703-12-12
-12-16	3/4"-14	1"-11	41	32	20,0	-12-16
-16-12	1"-11	3/4"-14	32	41	20,0	-16-12
-16-16	1"-11	1"-11	41	41	20,0	-16-16
-20-16	1 1/4"-11	1"-11	50	38	16,0	-20-16
-20-20	1 1/4"-11	1 1/4"-11	50	50	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	55	55	12,5	-24-24
-32-32	2"-11	2"-11	70	70	8,0	-32-32

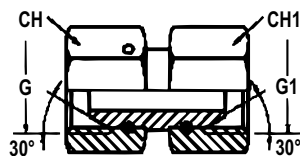


030702 Adapter inv. rörlig R-gänga/Do

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH	CH1		
030702-04-04	1/4"-19	1/4"-19	19	19	35,0	038702-04-04
-06-06	3/8"-19	3/8"-19	22	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	27	27	31,5	-08-08
-10-10	5/8"-14	5/8"-14	30	30	28,0	
-12-12	3/4"-14	3/4"-14	32	32	25,0	-12-12
-16-16	1"-11	1"-11	38	38	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	50	50	16,0	
-24-24	1 1/2"-11	1 1/2"-11	55	55	12,5	

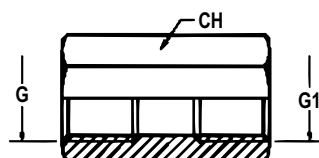


036889 Rörmuff inv. R-gänga

Det.nr.	Gänga BSP		Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	G1			
036889-02-02	1/8"-28	1/8"-28	14	35,0	038889-02-02
-02-04	1/8"-28	1/4"-19	19	35,0	-02-04
-02-06	1/8"-28	3/8"-19	22	35,0	-02-06
-04-04	1/4"-19	1/4"-19	19	35,0	-04-04
-04-06	1/4"-19	3/8"-19	22	35,0	-04-06
-04-08	1/4"-19	1/2"-14	27	31,5	-04-08
-06-06	3/8"-19	3/8"-19	22	35,0	-06-06
-06-08	3/8"-19	1/2"-14	27	31,5	-06-08
-06-12	3/8"-19	3/4"-14	32	25,0	-06-12
-08-08	1/2"-14	1/2"-14	27	31,5	-08-08
-08-10	1/2"-14	5/8"-14	30	31,5	-08-10
-08-12	1/2"-14	3/4"-14	32	25,0	-08-12
-08-16	1/2"-14	1"-11	41	20,0	-08-16
-10-10	5/8"-14	5/8"-14	30	31,5	
-12-12	3/4"-14	3/4"-14	32	25,0	038889-12-12
-12-16	3/4"-14	1"-11	41	20,0	-12-16
-16-16	1"-11	1"-11	41	20,0	-16-16
-16-20	1"-11	1 1/4"-11	50	16,0	-16-20
-20-20	1 1/4"-11	1 1/4"-11	50	16,0	-20-20
-20-24	1 1/4"-11	1 1/2"-11	55	12,5	-20-24
-24-24	1 1/2"-11	1 1/2"-11	55	12,5	-24-24
-24-32	1 1/2"-11	2"-11	70	8,0	-24-32
-32-32	2"-11	2"-11	70	8,0	-32-32

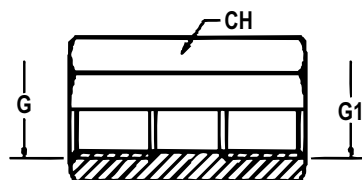


030289 Rörmuff inv. M-gänga

Det.nr.	Gänga Metrisk		Dimension mm
	G	G1	CH
030289-12-12	M12x1,5	M12x1,5	19
-14-14	M14x1,5	M14x1,5	19
-16-16	M16x1,5	M16x1,5	22
-18-18	M18x1,5	M18x1,5	22
-22-22	M22x1,5	M22x1,5	27

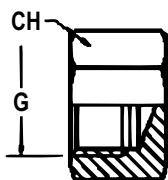


030150 Huv inv. R-gänga

Det.nr.	Gänga	Dimension mm	Arb.tryck MPa
	G	CH	
030150-02-00	1/8"-28	14	35,0
-04-00	1/4"-19	19	35,0
-06-00	3/8"-19	22	35,0
-08-00	1/2"-14	27	31,5
-12-00	3/4"-14	32	25,0
-16-00	1"-11	41	20,0
-20-00	1 1/4"-11	50	16,0
-24-00	1 1/2"-11	55	12,5
-32-00	2"-11	70	8,0

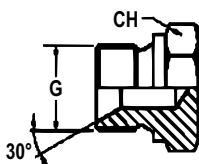


030151 Plugg R-gänga

Det.nr.	Gänga	Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	CH		
030151-02-00	1/8"-28	14	35,0	038151-02-00
-04-00	1/4"-19	19	35,0	-04-00
-06-00	3/8"-19	22	35,0	-06-00
-08-00	1/2"-14	27	31,5	-08-00
-10-00	5/8"-14	30	31,5	
-12-00	3/4"-14	32	25,0	038151-12-00
-16-00	1"-11	41	20,0	-16-00
-20-00	1 1/4"-11	50	16,0	-20-00
-24-00	1 1/2"-11	55	12,5	-24-00
-32-00	2"-11	70	8,0	-32-00

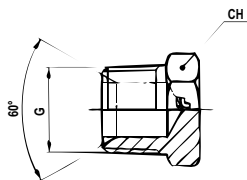

030152 Plugg NPTF-gänga


Det.nr.	Gänga	Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	CH		
030152-02-00	1/8"-27	14	35,0	038152-02-00
-04-00	1/4"-18	14	35,0	-04-00
-06-00	3/8"-18	19	25,0	-06-00
-08-00	1/2"-14	22	22,5	-08-00
-12-00	3/4"-14	27	20,0	-12-00
-16-00	1"-11,5	38	16,0	-16-00
-20-00	1 1/4"-11,5	50	16,0	-20-00
-24-00	1 1/2"-11,5	50	16,0	-24-00
-32-00	2"-11,5	70	10,0	-32-00

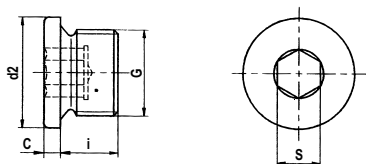

030153 Insexplugg för tredö, DIN 908


Det.nr.	Gänga	Dimension mm			
	G	d2	C ±0,5	i ±0,2	S
030153-02-00	G 1/8"	14	3	8	5
-04-00	G 1/4"	18	3	12	6
-06-00	G 3/8"	22	3	12	8
-08-00	G 1/2"	26	4	14	10
-12-00	G 3/4"	32	4	16	12
-16-00	G 1"	39	5	16	17
-20-00	G 1 1/4"	49	5	16	22
-24-00	G 1 1/2"	55	5	16	24
-32-00	G 2"	68	5	20	32

Metrisk versioner på förfrågan.

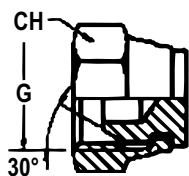

030155 Blindmutter inv. R-gänga 60° kona

Det.nr.	Gänga	Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	CH		
030155-02-00	1/8"-28	14	35,0	038155-04-00 -06-00 -08-00 -12-00 -16-00
-04-00	1/4"-19	19	35,0	
-06-00	3/8"-19	22	35,0	
-08-00	1/2"-14	27	31,5	
-12-00	3/4"-14	32	25,0	
-16-00	1"-11	41	20,0	
-20-00	1 1/4"-11	50	16,0	
-24-00	1 1/2"-11	55	12,5	
-32-00	2"-11	70	8,0	

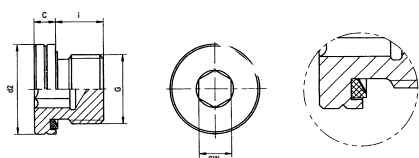


70125 Insexplugg med mjuktätning i nitril

Det.nr.	Gänga	Dimension mm				Arb.tryck MPa	
	G	d2	C	i	SW		MA*
7012502010	G 1/8"	14	4,0	8	5	40,0	10
7012504010	G 1/4"	19	5,0	12	6	40,0	26
7012506010	G 3/8"	22	5,0	12	8	40,0	34
7012508010	G 1/2"	27	5,0	14	10	40,0	60
7012512010	G 3/4"	32	5,0	16	12	40,0	85
7012516010	G 1"	40	6,5	16	17	40,0	130
7012520010	G 1 1/4"	50	6,5	16	22	31,5	240
7012524010	G 1 1/2"	55	6,5	16	24	31,5	280
7012510020	M 10x1"	14	4,0	8	5	40,0	10
7012512020	M 12x1,5"	17	5,0	12	6	40,0	20
7012514020	M 14x1,5"	19	5,0	12	6	40,0	30
7012516020	M 16x1,5"	22	5,0	12	8	40,0	34
7012518020	M 18x1,5"	24	5,0	12	8	40,0	42
7012520020	M 20x1,5"	26	5,0	14	10	40,0	50
7012522020	M 22x1,5"	27	5,0	14	10	40,0	60
7012526020	M 26x1,5"	32	5,0	16	12	40,0	70
7012527020	M 27x2"	32	5,0	16	12	40,0	85
7012533020	M 33x2"	40	6,5	16	17	40,0	130
7012542020	M 42x2"	50	6,5	16	22	31,5	240
7012548020	M 48x2"	55	6,5	16	24	31,5	280


Lagerförs i syrafast utförande med tätning i viton.

* Rekommenderat ådragningsmoment.

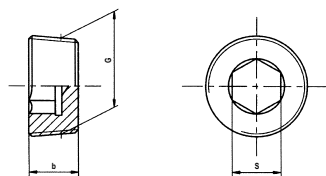


70126 Insexplugg DIN 906

Det.nr.	Gänga	Dimension mm	
		b	s
7012602010	R 1/8"	8	5
04010	R 1/4"	10	7
06010	R 3/8"	10	8
08010	R 1/2"	10	10
12010	R 3/4"	12	12
16010	R 1"	12	17
20010	R 1 1/4"	18	22
24010	R 1 1/2"	20	24
32010	R 2"	22	32

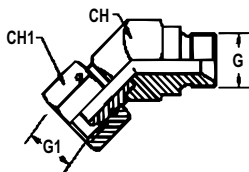


030045 Vinkeladapter 45° utv. fast R-gänga/inv. rörlig R-gänga

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa
	G	G1	CH1	CH	
030045-04-04	1/4"-19	1/4"-19	19	19	35,0
-06-06	3/8"-19	3/8"-19	22	22	35,0
-08-08	1/2"-14	1/2"-14	27	27	31,5
-12-12	3/4"-14	3/4"-14	32	32	25,0
-16-16	1"-11	1"-11	38	41	20,0

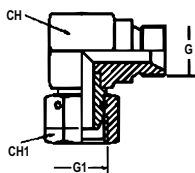


030090 Vinkeladapter 90° utv. fast R-gänga/inv. rörlig R-gänga

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH1	CH		
030090-02-02	1/8"-28	1/8"-28	14	14	35,0	038090-04-04 -06-06 -08-08 -12-12 -16-16 -20-20
-04-04	1/4"-19	1/4"-19	19	19	35,0	
-06-06	3/8"-19	3/8"-19	22	22	31,5	
-08-08	1/2"-14	1/2"-14	27	27	25,0	
-12-12	3/4"-14	3/4"-14	32	32	20,0	
-16-16	1"-11	1"-11	41	41	16,0	
-20-20	1 1/4"-11	1 1/4"-11	50	50	12,5	

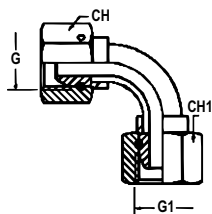


030487 Rörbøj 90° inv. rörlig R-gänga/Do

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH	CH1		
030487-04-04	1/4"-19	1/4"-19	19	19	35,0	038487-04-04
-06-06	3/8"-19	3/8"-19	22	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	27	27	31,5	-08-08
-12-12	3/4"-14	3/4"-14	32	32	25,0	-12-12
-16-16	1"-11	1"-11	38	38	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	50	50	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	55	55	12,5	-24-24
-32-32	2"-11	2"-11	70	70	8,0	-32-32

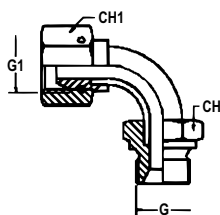


030488 Rörbøj 90° utv. fast R-gänga/inv. rörlig R-gänga

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH	CH1		
030488-04-04	1/4"-19	1/4"-19	19	19	35,0	038488-04-04
-06-06	3/8"-19	3/8"-19	22	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	27	27	31,5	-08-08
-12-12	3/4"-14	3/4"-14	32	32	25,0	-12-12
-16-16	1"-11	1"-11	41	38	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	50	50	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	55	55	12,5	-24-24
-32-32	2"-11	2"-11	65	70	8,0	-32-32

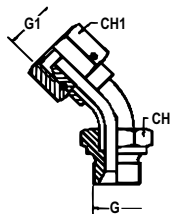


030489 Rörböj 45° utv. fast R-gänga/inv. rörlig R-gänga

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH	CH1		
030489-04-04	1/4"-19	1/4"-19	19	19	35,0	038489-04-04
-06-06	3/8"-19	3/8"-19	22	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	27	27	31,5	-08-08
-12-12	3/4"-14	3/4"-14	32	32	25,0	-12-12
-16-16	1"-11	1"-11	41	41	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	50	50	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	55	55	12,5	-24-24
-32-32	2"-11	2"-11	65	70	8,0	-32-32

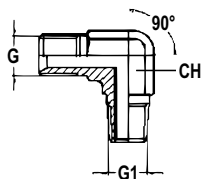


030822 Vinkeladapter 90° utv. R-gänga/utv. KR-gänga

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	BSP	KR			
	G	G1	CH		
030822-02-02	1/8"-28	1/8"-28	12	35,0	038822-02-02
-04-04	1/4"-19	1/4"-19	14	35,0	-04-04
-06-06	3/8"-19	3/8"-19	19	35,0	-06-06
-08-08	1/2"-14	1/2"-14	22	31,5	-08-08
-12-12	3/4"-14	3/4"-14	27	25,0	-12-12
-16-16	1"-11	1"-11	33	20,0	-16-16

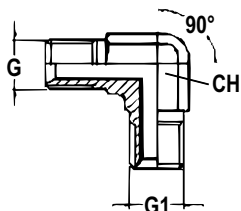


030820 Vinkeladapter 90° utv. R-gänga

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH		
030820-04-04	1/4"-19	1/4"-19	14	35,0	038820-04-04
-06-06	3/8"-19	3/8"-19	19	35,0	-06-06
-08-08	1/2"-14	1/2"-14	22	31,5	-08-08
-12-12	3/4"-14	3/4"-14	27	25,0	-12-12
-16-16	1"-11	1"-11	33	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	41	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	48	12,5	-24-24

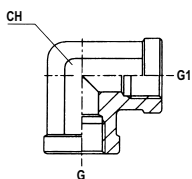


030840 Vinkeladapter inv. R-gänga, fast

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	G	G1	CH	
030840-02-02	1/8"-28	1/8"-28	14	35,0
-04-04	1/4"-19	1/4"-19	19	35,0
-06-06	3/8"-19	3/8"-19	22	25,0
-08-08	1/2"-14	1/2"-14	27	22,5
-12-12	3/4"-14	3/4"-14	33	20,0
-16-16	1"-11	1"-11	41	16,0
-20-20	1 1/4"-11	1 1/4"-11	48	16,0
-24-24	1 1/2"-11	1 1/2"-11	65	16,0
-32-32	2"-11	2"-11	71	10,0

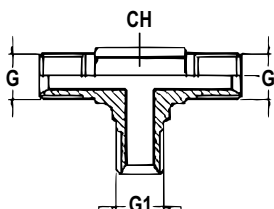


030850 T-adapter utv. R-gänga/KR-gänga

Det.nr.	Gänga		Dimension mm	Arb.tryck MPa
	BSP G	KR G1		
030850-02-02	1/8"-28	1/8"-28	11,5	35,0
-04-04	1/4"-19	1/4"-19	14,0	35,0
-06-06	3/8"-19	3/8"-19	19,0	35,0
-08-08	1/2"-14	1/2"-14	22,0	31,5
-12-12	3/4"-14	3/4"-14	27,0	20,0
-16-16	1"-11	1"-11	33,0	16,0

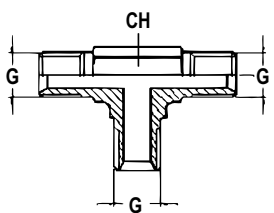


030851 T-adapter utv. R-gänga

Det.nr.	Gänga	Dimension mm	Arb.tryck MPa	Det.nr. syrafast
	G	CH		
030851-02-02	1/8"-28	12	35,0	038851-02-02
-04-04	1/4"-19	14	35,0	-04-04
-06-06	3/8"-19	19	35,0	-06-06
-08-08	1/2"-14	22	31,5	-08-08
-12-12	3/4"-14	27	25,0	-12-12
-16-16	1"-11	33	20,0	-16-16
-20-20	1 1/4"-11	41	16,0	-20-20
-24-24	1 1/2"-11	48	12,5	-24-24

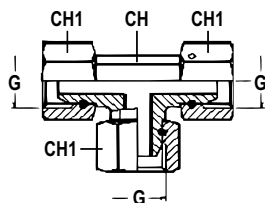


030852 T-adapter inv. rörlig R-gänga

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa	Det.nr. syrafast
	G		CH	CH1		
030852-04-04	1/4"-19		14	19	35,0	038852-04-04
-06-06	3/8"-19		19	22	35,0	-06-06
-08-08	1/2"-14		22	27	31,5	-08-08
-12-12	3/4"-14		27	32	25,0	-12-12
-16-16	1"-11		33	38	20,0	-16-16
-20-20	1 1/4"-11		41	50	16,0	-20-20
-24-24	1 1/2"-11		50	55	12,5	-24-24

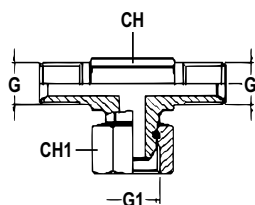


030853 T-adapter utv. fast R-gänga/inv. rörlig R-gänga

Det.nr.	Gänga				Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH	CH1		
030853-04-04	1/4"-19	1/4"-19	14	19	35,0	038853-04-04
-06-06	3/8"-19	3/8"-19	19	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	22	27	31,5	-08-08
-12-12	3/4"-14	3/4"-14	27	32	25,0	-12-12
-16-16	1"-11	1"-11	33	41	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	41	50	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	48	60	12,5	-24-24

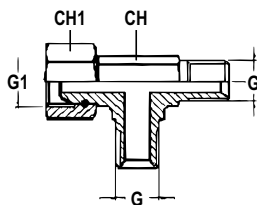


030855 L-adapter utv. fast R-gänga/inv. rörlig R-gänga

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa	Det.nr. syrafast
	G	G1	CH	CH1		
030855-04-04	1/4"-19	1/4"-19	14	19	35,0	038855-04-04
-06-06	3/8"-19	3/8"-19	19	22	35,0	-06-06
-08-08	1/2"-14	1/2"-14	22	27	31,5	-08-08
-12-12	3/4"-14	3/4"-14	27	32	25,0	-12-12
-16-16	1"-11	1"-11	33	41	20,0	-16-16
-20-20	1 1/4"-11	1 1/4"-11	41	50	16,0	-20-20
-24-24	1 1/2"-11	1 1/2"-11	48	55	12,5	-24-24

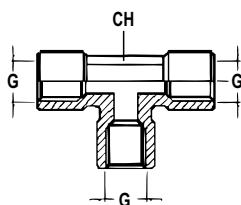


030860 T-adapter inv. R-gänga, fast

Det.nr.	Gänga	Dimension mm	Arb.tryck MPa
	G	CH	
030860-02-02	1/8"-28	14	35,0
-04-04	1/4"-19	19	35,0
-06-06	3/8"-19	22	25,0
-08-08	1/2"-14	27	22,5
-12-12	3/4"-14	33	20,0
-16-16	1"-11	41	16,0
-20-20	1 1/4"-11	48	16,0
-24-24	1 1/2"-11	65	16,0
-32-32	2"-11	71	10,0

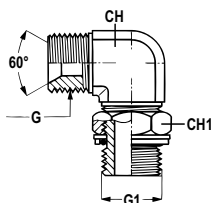

030401 Vinkeladapter 90° utv. R-gänga, ställbar


Det.nr.	Gänga		Dimension mm		Arb.tryck MPa
	G	G1	CH	CH1	
030401-02-02	1/8"-28	1/8"-28	12	14	35,0
-04-04	1/4"-19	1/4"-19	14	19	35,0
-06-04	3/8"-19	1/4"-19	19	19	25,0
-06-06	3/8"-19	3/8"-19	19	24	25,0
-06-08	3/8"-19	1/2"-14	22	27	22,5
-08-06	1/2"-14	3/8"-19	22	24	22,5
-08-08	1/2"-14	1/2"-14	22	27	22,5
-08-12	1/2"-14	3/4"-14	27	36	20,0
-12-08	3/4"-14	1/2"-14	27	27	20,0
-12-12	3/4"-14	3/4"-14	27	36	20,0
-16-12	1"-11	3/4"-14	33	36	16,0
-16-16	1"-11	1"-11	33	41	16,0
-20-20	1 1/4"-11	1 1/4"-11	41	50	16,0
-24-24	1 1/2"-11	1 1/2"-11	48	60	16,0

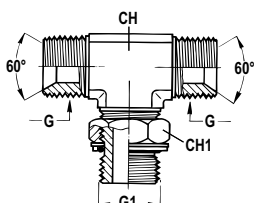

030403 T-adapter utv. R-gänga, ställbar

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa
	G	G1	CH	CH1	
030403-02-02	1/8"-28	1/8"-28	12	14	35,0
-04-04	1/4"-19	1/4"-19	14	19	35,0
-06-06	3/8"-19	3/8"-19	19	24	25,0
-06-08	3/8"-19	1/2"-14	22	27	22,5
-08-06	1/2"-14	3/8"-19	22	24	22,5
-08-08	1/2"-14	1/2"-14	22	27	22,5
-12-12	3/4"-14	3/4"-14	27	36	20,0
-16-16	1"-11	1"-11	33	41	16,0
-20-20	1 1/4"-11	1 1/4"-11	41	50	16,0
-24-24	1 1/2"-11	1 1/2"-11	48	60	16,0


Andra dimensioner på förfrågan.

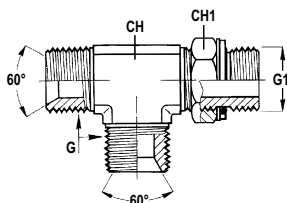

030404 L-adapter utv. R-gänga, ställbar

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa
	G	G1	CH	CH1	
030404-02-02	1/8"-28	1/8"-28	12	14	35,0
-04-04	1/4"-19	1/4"-19	14	19	35,0
-06-06	3/8"-19	3/8"-19	19	24	25,0
-08-08	1/2"-14	1/2"-14	22	27	22,5
-12-12	3/4"-14	3/4"-14	27	36	20,0
-16-16	1"-11	1"-11	33	41	16,0
-20-20	1 1/4"-11	1 1/4"-11	41	50	16,0
-24-24	1 1/2"-11	1 1/2"-11	48	60	16,0


Andra dimensioner på förfrågan.

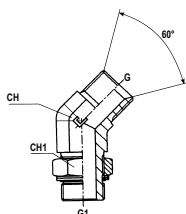

030402 Vinkeladapter 45° utv. R-gänga, ställbar


Det.nr.	Gänga		Dimension mm		Arb.tryck MPa
	G	G1	CH	CH1	
030402-02-02	1/8"-28	1/8"-28	12	14	35,0
-04-04	1/4"-19	1/4"-19	14	19	35,0
-06-06	3/8"-19	3/8"-19	19	24	25,0
-08-08	1/2"-14	1/2"-14	22	27	22,5
-12-12	3/4"-14	3/4"-14	27	36	20,0
-16-16	1"-11	1"-11	33	41	16,0
-20-20	1 1/4"-11	1 1/4"-11	41	50	16,0
-24-24	1 1/2"-11	1 1/2"-11	48	60	16,0

Andra dimensioner på förfrågan.

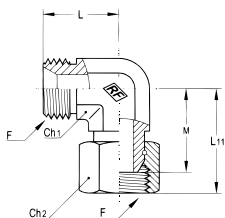


030407 Vinkeladapter 90° utv. R-gänga, ställbar

Det.nr.	Gänga		Dimension mm		Arb.tryck MPa
	G	G1	CH1	CH2	
030407-02-02	1/8"-28	1/8"-28	12	14	35,0
-04-04	1/4"-19	1/4"-19	14	19	35,0
-06-06	3/8"-19	3/8"-19	19	22	25,0
-08-08	1/2"-14	1/2"-14	22	27	22,5
-12-12	3/4"-14	3/4"-14	27	32	20,0
-16-16	1"-11	1"-11	33	41	16,0
-20-20	1 1/4"-11	1 1/4"-11	41	50	16,0
-24-24	1 1/2"-11	1 1/2"-11	48	60	16,0

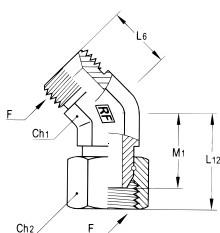

030408 Vinkeladapter 45° utv. inv. R-gänga


Det.nr.	Gänga		Dimension mm		Arb.tryck MPa
	G	G1	CH1	CH2	
030408-02-02	1/8"-28	1/8"-28	12	14	35,0
-04-04	1/4"-19	1/4"-19	14	19	35,0
-06-06	3/8"-19	3/8"-19	19	22	25,0
-08-08	1/2"-14	1/2"-14	22	27	22,5
-12-12	3/4"-14	3/4"-14	27	32	20,0
-16-16	1"-11	1"-11	33	41	16,0
-20-20	1 1/4"-11	1 1/4"-11	41	50	16,0
-24-24	1 1/2"-11	1 1/2"-11	48	60	16,0

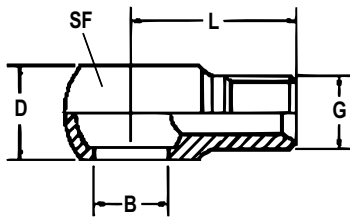

030830 Banjoadapter, utv. R-gänga


Det.nr.	Gänga		Dimension mm			Arb.tryck MPa
	B	G	L	SF	D	
030830-04-04	1/4"	1/4"-19	24	24	15	35,0
-06-04	3/8"	1/4"-19	25	28	18	35,0
-06-06	3/8"	3/8"-19	28	28	18	35,0
-08-08	1/2"	1/2"-14	32	35	22	31,5
-12-12	3/4"	3/4"-14	40	45	29	25,0
-16-16	1"	1"-11	44	60	37	20,0

Andra dimensioner och metrisk gänga på förfrågan.

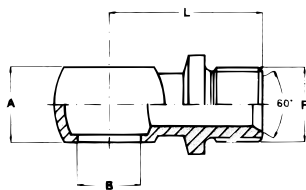

030831 Banjoadapter med fläns, utv. R-gänga

Det.nr.	Gänga		Dimension mm			Arb.tryck MPa
	B	G	L	SF	A	
030831-04-04	1/4"	1/4"-19	31	24	14	35,0
-06-06	3/8"	3/8"-19	40	28	18	35,0
-08-08	1/2"	1/2"-14	55	35	22	31,5

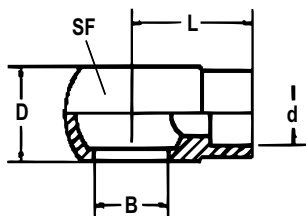

030833 Lödbanjo

Det.nr.	Hål för gänga	Dimension mm				Arb.tryck MPa
		B	d	L	SF	
030833-04-08	1/4"	8	24	24	14	35,0
-04-10	1/4"	10	24	24	14	35,0
-06-08	3/8"	8	28	28	18	35,0
-06-10	3/8"	10	28	28	18	35,0
-08-15	1/2"	15	32	35	22	31,5
-14-08	14 mm	8	24	24	14	31,5
-14-10	14 mm	10	24	24	14	31,5
-16-10	16 mm	10	28	28	18	31,5
-18-10	18 mm	10	29	32	20	31,5

Andra dimensioner på förfrågan.

Tryckrekommendationer för anslutningar nippel/adapter

Beskrivning	Standards	Tryck (Bar)										
		Storlek										
		03	04	05	06	08	10	12	16	20	24	32
UTVÄNDIG BSPP	BS5200-ISO WD84346	350	350	350	350	315	315	250	200	160	125	80
INVÄNDIG BSPP O-RING	BS5200-ISO WD84346		400		400	350	350	315	250	200	160	125
INVÄNDIG BSPP	BS5200-ISO WD84346		350	350	350	315	315	250	200	160	125	80
INVÄNDIG MULTISEAL	DIN20066	250	250	250	250	250	160					
INVÄNDIG METRISK 60	DIN20066							63	63	63	63	40
UTVÄNDIG METRISK 24 DKOL	DIN20066	250	250	250	250	250	160	160	100	100	100	
INVÄNDIG METRISK 24 DKOL	DIN20066	250	250	250	250	250	160	160	100	100	100	
UTVÄNDIG METRISK 24 DKOS	DIN20066	630	630	630	630	400	400	400	250	250		
INVÄNDIG METRISK 24 DKOS	DIN20066	630	630	630	630	400	400	400	250	250		
INVÄNDIG METRISK JIS	JIS B8363	350	350	350	350	350	280	280	280	170	105	105
INVÄNDIG GAS JIS	JIS B8363	350	350	350	350	350	280	280	280	170	105	105
UTVÄNDIG JIC 37	SAE 514	345	345	345	345	310	240	240	210	170	140	105
INVÄNDIG JIC 37	SAE 514	310	275	275	275	275	210	210	170	140	105	80
UTVÄNDIG NPTF	SAE 514	345	345	276	276	241	155	155	138	112	86	78
INVÄNDIG ORFS	SAE J1453/ISO 8434	413	413	413	413	413	413	413	345	275	207	
FLÄNS 3000	SAE 518					345		345	345	276	207	207
FLÄNS 6000	SAE 518					414		414	414	414	414	414

Upp till 250 Bar

Upp till 350 Bar

Upp till 630 Bar